

---

## CAE PERFORMANCE PRODUCTS PTY/LTD

Pyrenees Hwy Chewton, VIC. 3450  
Telephone : ( 03 ) 5472 1442 - Fax ( 03 ) 5472 4111

---

### **CH-93 LC, LJ TORANA WITH GEN III**

- Grind lip off sub frame as shown in fig A and fig B and weld as required, this work should be carried out by a qualified welder.



Fig A



Fig B

- Remove all spark plugs
- It is recommended that all work to be carried out is to be done on a hoist.
- Bolt transmission cross member into position as shown in fig D (part no. XMLCJ-T56)
- Lay extractors in engine bay as shown fig C

---

# CAE PERFORMANCE PRODUCTS PTY/LTD

Pyrenees Hwy Chewton, VIC. 3450  
Telephone : ( 03 ) 5472 1442 - Fax ( 03 ) 5472 4111

---

## CH-93 LC, LJ TORANA WITH GEN III

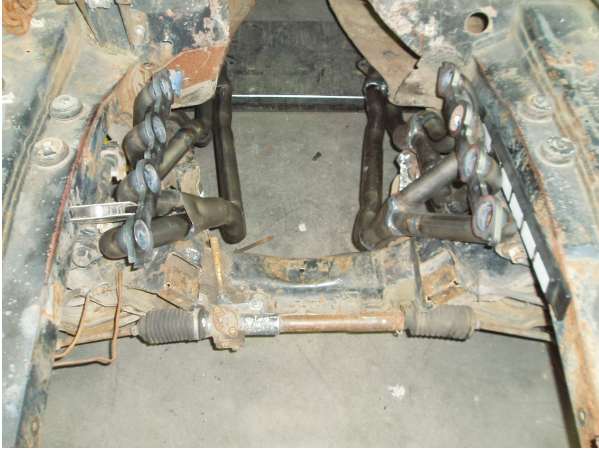


Fig C

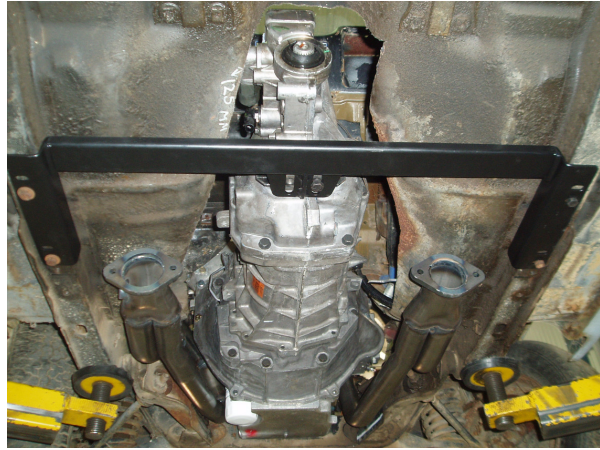


Fig D

- Lower motor into engine bay carefully Fig E
- Bolt extractors onto the heads and gearbox to X-member
- Fit starter motor and steering in this order as shown in Fig F



Fig E



Fig F

---

## **CAE PERFORMANCE PRODUCTS PTY/LTD**

Pyrenees Hwy Chewton, VIC. 3450  
Telephone : ( 03 ) 5472 1442 - Fax ( 03 ) 5472 4111

---

### **CH-93 LC, LJ TORANA WITH GEN III**

Note:

Steering column needs to be re-positioned closer to the sub frame using our steering column base plate.

Part No. ST.C.PLATE.

2 new steering universals will have to be fitted as per Fig F. These can be supplied by C.A.E.

Part No. ST.UNI-02

These headers are designed to be used with our engine mounts Pt. No. CH-EM70 and TRANS X/MEMBER

Note: We recommend using Permatex Ultra Blue RTV silicone gasket maker. This is Cat Converter and Oxy sensor safe.